

Acoustical Testing Laboratory



Accredited by the National Voluntary Laboratory Accreditation Program for the specific scope of accreditation unde Lab Code 200291

Page 1 of 5

TEST REPORT

for

Regupol America LLC

11 Ritter Way Lebanon, PA 17042 Florian Sassmannshausen / 717-675-2190

Sound Transmission Loss Test

ASTM E 90 – 09 / E 413 – 10

On

6 Inch Concrete Slab Floor – Ceiling Assembly Overlaid with 1 layer of Regupol Vibration 300 (17 mm) and a 4 Inch Concrete Slab

Report Number: NGC 5016058

Assignment Number: G-1296

Test Date: 05/12/2016

Report Approval Date: 05/19/2016

Submitted by:
Anthony J. Rivers

Test Technician

Reviewed by:

Robert J. Menchetti

Director

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.



Acoustical Testing Laboratory



Accredited by the National Voluntary Laboratory Accreditation Program for the specific scope of accreditation unde Lab Code 200291

NGC 5016058 Regupol America LLC. 05/19/2016 Page 2 of 5

Revision Summary:

Date	SUMMARY		
Approval Date: 05/19/2016	Original issue date: 05/19/2016		
	Original NGCTS report #: NGC 5016058		

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.



Laboratory



Accredited by the National Voluntary Laboratory Accreditation Program for the specific scope of accreditation unde Lab Code 200291

NGC 5016058 Report Number:

Page 3 of 5

Test Method:

This test method conforms explicitly with the American Society for Testing and Materials Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements -

Designation: E 90 - 09 / E 413 - 10.

Specimen Description:

6 inch concrete slab floor-ceiling assembly, overlaid with according to client, 1 layer of Regupol Vibration 300 (17 mm) and a 4 inch concrete slab.

The test specimen was a floor-ceiling assembly and was observed to consist of the following: All weights and dimension are averaged:

- 101.6 mm (4 in.) thick reinforced concrete slab, weighing: 223.30 kg/m² (45.74 PSF)
- 1 layer of, according to the client, Regupol Vibration 300 (17 mm). The Regupol Vibration 300 (17 mm) was floating on the 6 inch concrete slab. Measured thickness: 18.03 mm (0.71 in.). Measured weight: $7.23 \text{ kg/m}^2 (1.48 \text{ PSF})$
- 152.4 mm (6 in.) thick reinforced concrete slab, weighing: 366.15 kg/m² (75.0 PSF)

The overall weight of the test assembly is: 596.68 kg/m² (122.22 PSF)

The perimeter of the test frame was sealed with a rubber gasket and a sand filled trough.

The test frame was structurally isolated from the receiving room.

3657.6 mm x 4876.8 mm (12 ft. x 16 ft.) Specimen size:

Conditioning: Concrete slab cured for a minimum of 28 days.

Test Results: The results of the tests are given on pages 4 and 5 of the report.

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.



Laboratory



Accredited by the National Voluntary Laboratory Accreditation Program for the specific scope of accreditation unde Lab Code 200291

Sound Transmission Loss Test Data

Test: ASTM E 90 - 04 / ASTM E 413 - 10

Page 4 of 5

Test Report: NGC 5016058 Date: 5/12/2016

Specimen Size [m²]: 17.8

Receiving room

Volume [m³]: 84.75 Rm Temp [°C]: 20 Humidity [%]: 60

Source room

Volume [m³]: 128 Rm Temp [°C]: 20 Humidity [%]:

Sound Transmission Class STC [dB]: 58

Sum of Unfavorable Deviations [dB]:

ax. Unfavorable Devi	iation [dB]:	6	at	250	Hz	3 7 22 85 S	
Frequency	STL	L1	L2	d	Corr.	u.Dev.	∆STL
[Hz]	[dB]	[dB]	[dB]	[dB/s]	[dB]	[dB]	
80	36	100.3	66.5	28.1	2.2		2.83
100	42	104.9	67.1	19.4	4.2		5.28
125	37	103.7	71.8	15.3	5.1	5	2.16
160	43	105.2	67.3	15.7	5.1	2	1.35
200	44	104.7	65.9	14.8	5.2	4	1.19
250	45	101.9	62.1	15.6	5.2	6	1.13
315	49	101.3	57.6	15.2	5.2	5	0.79
400	52	99.1	52.2	16.4	5.1	5	0.87
500	57	100.9	49.2	16.8	5.3	1	0.72
630	59	101.9	47.2	17.1	4.4		0.61
800	63	100.5	42.6	17.2	5.0		0.30
1000	66	98.6	37.2	16.9	4.7		0.68
1250	69	96.8	32.3	18.3	4.5		0.40
1600	72	97.3	29.0	19.9	3.7		0.94
2000	76	99.2	26.9	22.3	3.6		1.15
2500	78	100.9	26.6	24.1	3.7		1.16
3150	79	100.2	23.8	25.8	2.6		1.52
4000	82	97.8	18.5	29.8	2.7		2.05
5000	81	91.1	11.4	34.5	1.3		1.87

= Sound Transmission Loss, dB STL

= Source Room Level, dB L1

L2 = Receiving Room Level, dB

= Decay Rate dB/second

Δ STL = Uncertainty for 95% Confidence Level

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.



Laboratory



Accredited by the National Voluntary Laboratory Accreditation Program for the specific scope of accreditation unde Lab Code 200291

Sound Transmission Loss Test Data


Page 5 of 5


Per: ASTM E 90 - 04 / ASTM E 413 - 10

Test Report: NGC 5016058 Test Date: 5/12/2016 Specimen Size [m2]: 17.8

> Sound Transmission Class STC = 58 dB

Frequency	STL	ΔSTL				
[Hz]	[dB]					
80	36	2.83				
100	42	5.28				
125	37	2.16				
160	43	1.35				
200	44	1.19				
250	45	1.13				
315	49	0.79				
400	52	0.87				
500	57	0.72				
630	59	0.61				
800	63	0.30				
1000	66	0.68				
1250	69	0.40				
1600	72	0.94				
2000	76	1.15				
2500	78	1.16				
3150	79	1.52				
4000	82	2.05				
5000	81	1.87				



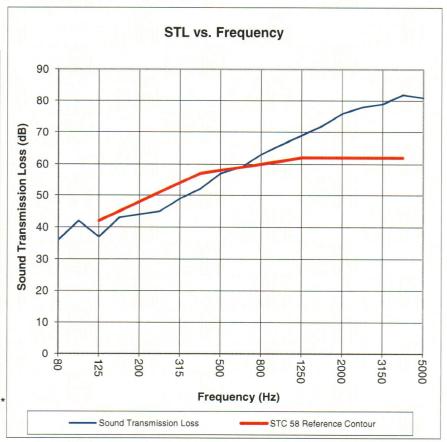

= Sound Transmission Loss, dB Δ STL = Uncertainty for 95% Confidence Level

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.